

Fiber Optic Sensor Amplifier Type FA1

CARLO GAVAZZI



- Distance range is fiber dependent
Please see the FUR, FUT datasheet
- Easy set-up using 3-ways adjustment switch
- 2 X 4 digits display to show signal level and threshold
- Display direction can be inverted to suit different mounting
- Output 100mA NPN or PNP
- Light on and dark on switching selectable
- Operational voltage 12 to 24 VDC
- On, off, on one shot, off one shot delay timer
- Response time 200, 500, 1000, 5000µs



Product Description

FA1 series amplifier is a fiber optic amplifier most suitable to be used with FUR/FUT fibers to achieve various detection distance.

FA1 has a 2 x 4 digits LED display to show the signal level and threshold respectively. Display direction can be inverted to suit different installation needs.

FA1 is also equipped with a 3-ways adjuster switch to adjust sensitivity and different response time.

The sensor output is either NPN or PNP and is selectable to be light on or dark on. There is also a timer for the output which can be selected to be on delay, off delay, on one shot and off one shot to suit most applications' needs.

Ordering Key FA 1-N

Type _____
 Series _____
 Output _____

Type Selection

Housing
W x H x D

10 x 33 x 80 mm

Ordering no.
NPN
Light on or dark on switching

FA1-N

Ordering no.
PNP
Light on or dark on switching

FA1-P

Specifications

Rated operating distance (S_n)	Fiber dependant Please see FUR, FUT datasheet	Output function Light on or dark on	NPN or PNP Selected via switch
Sensitivity	Increase or decrease by 3-ways adjuster switch. Switch left/right to +/- and press down to confirm	Timer	Type On, off, on one shot, off one shot Range 0-9999 ms
Sensitivity Range	Depends on selected response time 27-3991 @200µs 27-3982 @500µs 27-9988 @1000µs 27-9990 @5000µs	Current consumption (I_o)	< 40 mA @ 24 VDC
Temperature drift	< 0.2%/C°	Voltage drop (U_d) FA1-N FA1-P	≤1V (100 mA Load) ≤1.5V (100 mA Load)
Hysteresis (H)	≤ 20% of sensing distance	Protection	Short-circuit, reverse polarity, transients
Rated operational volt. (U_B)	12 to 24 VDC	Light source	Red LED 660 nm
Ripple (U_{rpp})	≤ 10%	Ambient light Incandescent light Sunlight	10'000 Lux 20'000 Lux
Output current Continuous (I _a)	100 mA	Operating frequency	Max. 2.5 kHz
		Response time	Selectable 200, 500, 1000, 5000µs




Specifications (cont.)


Power ON delay (t_v)	< 150 ms
Indication Output Sensitivity	Red LED 2 X 4 digits display Red – signal level Green - threshold
Temperature Operating	0° to +60°C (32° to +140°F)

Housing material Body	ABS
Connection Cable	PVC, black, 2m, 3 wires
Weight	Approx. 65g
Approvals	CE, cULus (UL508)
Environment Degree of protection	IP40


Operation Diagram

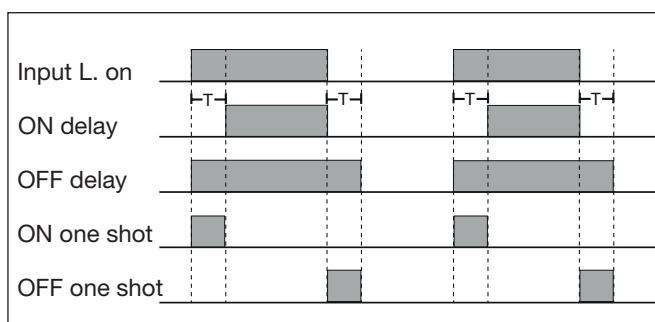



Wiring Diagram

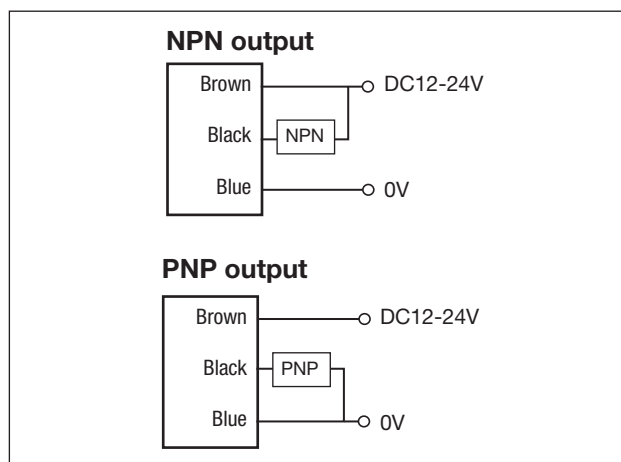


Dimensions

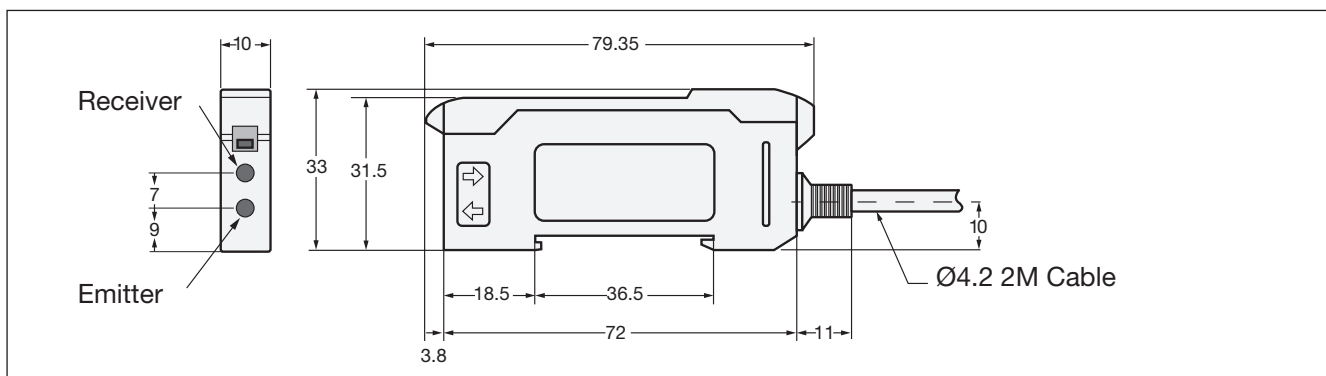

LED and Operation Panel

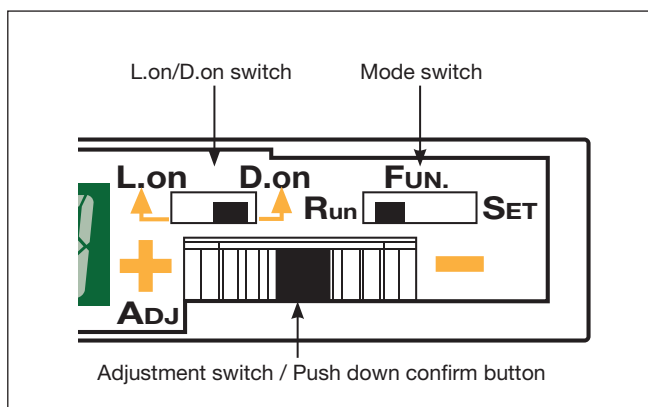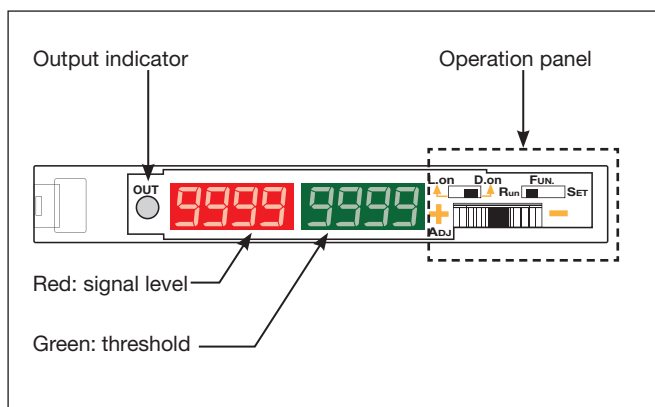

Block Diagram - Programming Settings

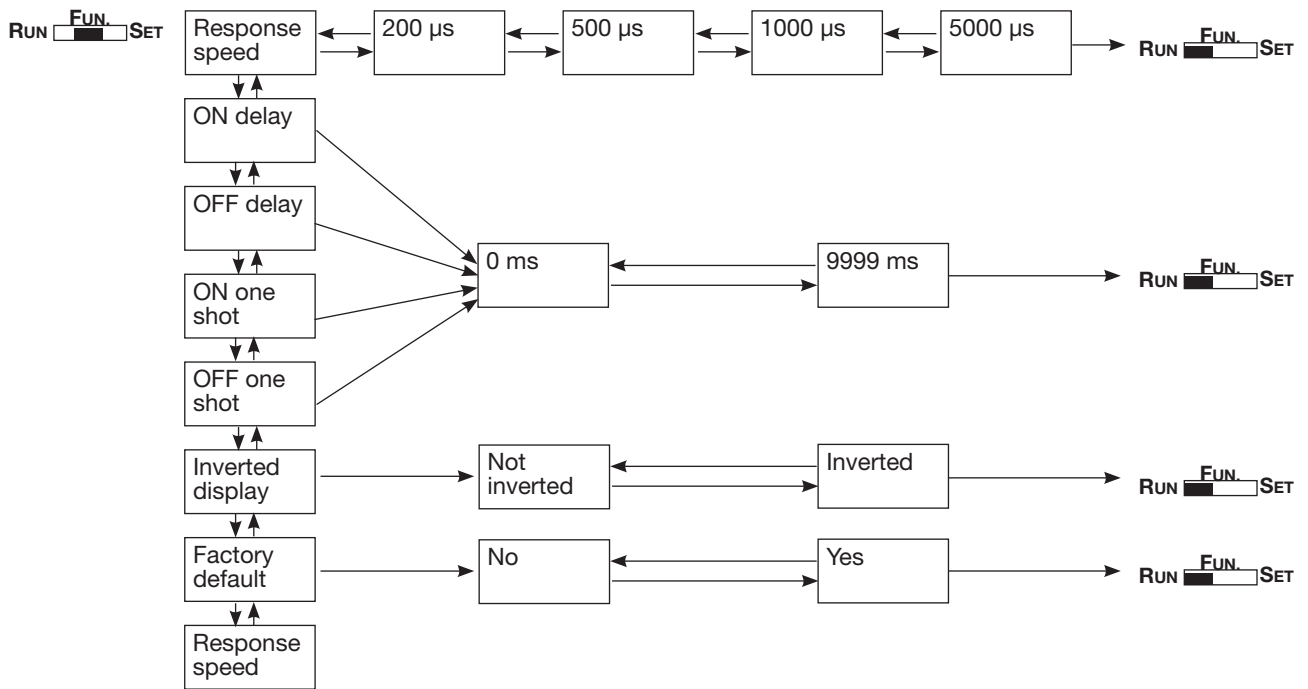




Programming Functions

<p>Settings</p>	<p>Mode switch: Select FUN. RUN FUN SET</p>	<p>Inverted display</p>	<p>dISP rERd Press ADJ for 2 sec.</p>
<p>Response speed</p> <p>Higher response time: shorter sensing distance. Lower response time: longer sensing distance.</p>	<p>rESP SPd Press ADJ for 2 sec.</p> <p>Turn to '+' to increase or '-' to decrease response time</p> <p>200 µS ↔ 500 µS 1000 µS ↔ 5000 µS</p> <p>Press ADJ for 2 sec. Return to RUN RUN FUN SET</p>	<p>Turn to '+' to increase or '-' to change between displays</p> <p>dISP 1234 ↔ hE21 dS'P</p> <p>Press ADJ for 2 sec. Return to RUN RUN FUN SET</p>	<p>Press ADJ for 2 sec. Return to RUN RUN FUN SET</p>
<p>ON delay</p> <p>OFF delay</p> <p>ON one shot</p> <p>OFF one shot</p>	<p>Setting delay time: 0-9999 ms</p> <p>0n dEL</p> <p>OFF dEL</p> <p>0n 1Sht</p> <p>OFF 1Sht</p> <p>Turn to '+' to increase or '-' to decrease delay time</p> <p>0 ↔ 9999</p> <p>Press ADJ for 2 sec. Return to RUN RUN FUN SET</p>	<p>Factory default</p>	<p>FctY dEF Press ADJ for 2 sec.</p> <p>Turn to '+' to increase or '-' to change between options (Yes/No)</p> <p>no ↔ YES</p> <p>Press ADJ for 2 sec. Return to RUN RUN FUN SET</p>



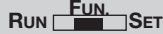


Programming Functions - Example

Setting example


Set OFF delay to 2 sec.

- Select FUN.

- Turn to '+' to or '-' to go to OFF delay mode

- Hold down for two sec.


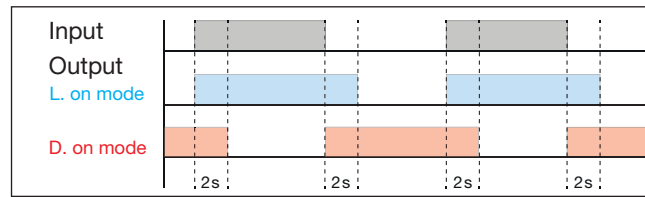
The display shows '0'


- Turn to '+' to set to 2000

- Hold down for two sec. to confirm setting (OFF delay)


- Return to RUN







Working position is now:





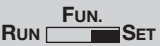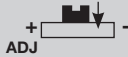


OFF delay 2 sec.




Diffuse model settings

- Set to L.on

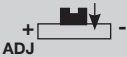- Select SET

- With target: hold down ADJ for 2 sec. Auto-teach-in function is performed when the blinking stops. (see fig. 1, p. 5)

- Return to RUN

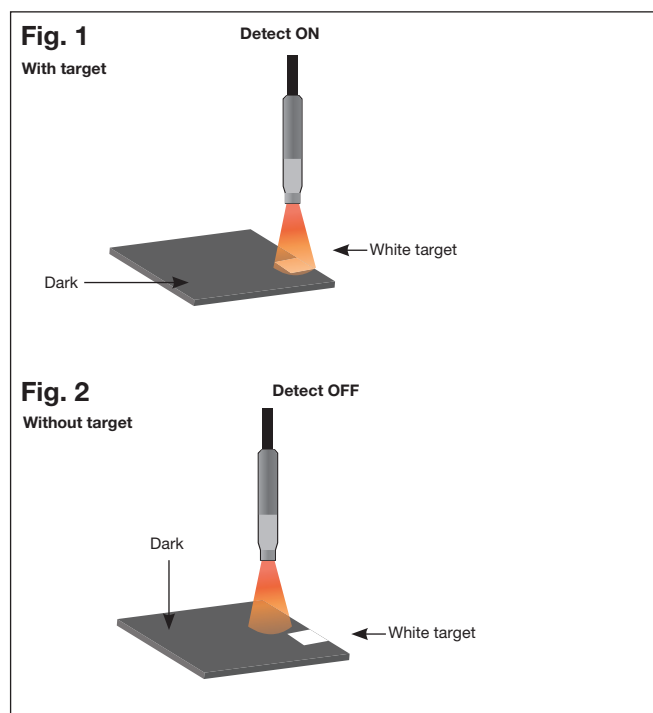- If reversed operation detection is required, change to D.on


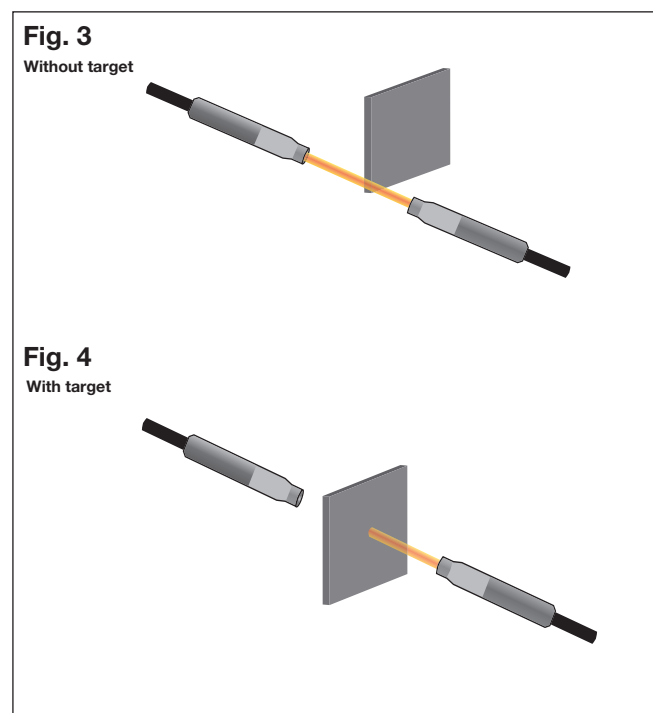
Through-beam model settings

- Set to D.on

- Select SET

- Without target; hold down ADJ for 2 sec. Auto-teach function is performed when the blinking stops. (see fig. 3, p. 5)

- Return to RUN

- If reversed operation detection is required, change to L.on


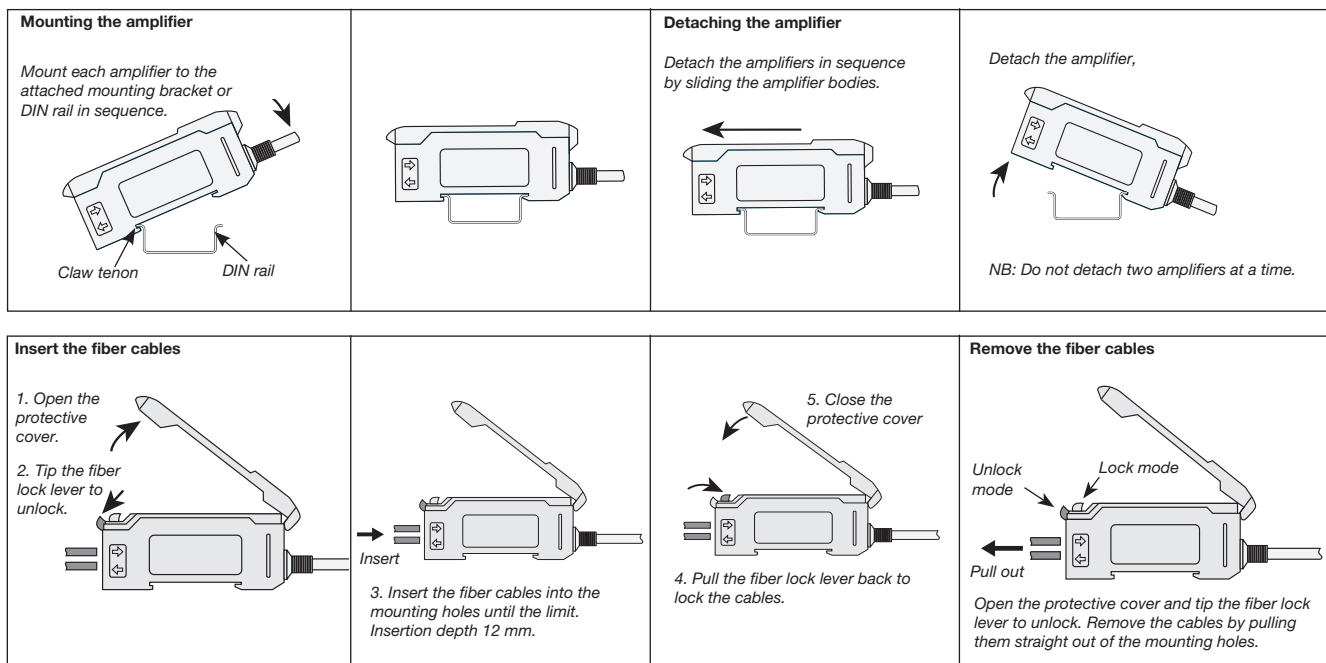
Diffuse model settings



Through-beam model settings



Installation Hints



Delivery Contents

- Amplifier: FA1...
- Installation manual
- **Packaging:** Cardboard box

Accessories

- Fiber optic plastic type FUR, FUT

For further information refer to Fiber Optic Plastic Type FUR, FUT datasheets.